



Aluskin Pant for Aluminum Smelter and Welding With Segmented 2" reflective tape

VPKA21

Inseam 31"

The fabric of AluSkin garments offers an optimal protection for workers exposed to molten metals such as foundry workers and welders by protecting them from molten splinters, flames and heat and provides category 2 protection for workers at risk from electric arcs. The comfortable, lightweight fabric blend and the fit of the garment make AluSkin the ideal protective garment.

Certifications

- This garment is certified with **NFPA 70E / ASTM F1506 (ASTM F1959)** specifications for arc flashes and flame resistant clothing (**Cat. 2**) **ATPV 12 cal/cm²**
- **EN11612 (A1 A2 B1 C1 D3 E3 F1)** for the resistance to heat, flame and molten splash
- **EN ISO 11611 (Class 2 - A1+A2)** for protection against welding projections
- Antistatic **EN1149-5**
- Comply with **CSA Z96-22** for tape position **Class 1, Level 2**

Fabric

- 54% FR Viscose / 20% Polyamide / 20% Wool / 5% Aramid / 1% Antistatic 330 gsm (9.73 oz/yd²)
- Nomex resistant thread
- FR 2" reflective tape Tested: EN ISO 20471 / EN ISO 533

Size:

31": 24 to 46



Slash pocket at sides with back pocket with flap button closure

Double layer fly closure with YKK zip




1/2 waist back elastic for comfort



Heavy Nomex resistant thread and reinforced seams at stress points

Segmented reflective 2" tape

Can be worn with Shirt:
VHKA01
VHKA60 (Becomes CSA Z96-22 Class 3, Level 2 when worn as a set)



SPECIFICATION SHEET

Protective Clothing

AluSkin



KOSTO
BUILT STRONG • BÂTI SOLIDE

Related Items

VHKA60
Aluskin Shirt
CSA



VHKAD6
Ladies Aluskin
Shirt




VCKA01
Aluskin
Coverall CSA



Care Guide

Care Instructions

- Protective garments should be cleaned regularly, as per recommended instructions.
- Wash all garments after fixing all closure systems.
- Strictly wash garments inside out.
- Always wash your Flame Retardant PPE separately to avoid some migration of flammable loose fibers or components.
- Please make sure that garments are properly rinsed after wash.
- Do not dry in direct sunlight as this may cause color to fade.
- After cleaning the garment, please inspect before re-use




Wash care instructions

- Wash in 60°C, do not use detergents containing soap & chlorine.
- Do not bleach, or use acids when rinsing.
- Iron at low setting (below 110°C).
- Use dry cleaning agent other than Trichloroethylene.
- Tumble dry allowed.

Size chart

VPKA21

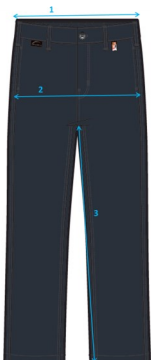

* Measurements are those of the product

* A fitting is always recommended

ALUSKIN PANT														
			24	26	28	30	32	34	36	38	40	42	44	46
Waist	1	po	24	26	28	30	32	34	36	38	40	42	44	46
	1	cm	60.7	66	71.1	76.2	81.3	86.4	91.4	96.5	101.6	106.7	111.8	116.8
Hips	2	po	33	35	37	39	41	43	45	47	49	51	53	55
	2	cm	83.8	88.9	94	99.1	104.1	109.2	114.3	119.4	124.5	129.5	134.6	139.7
Inseam 31	3	po	31	31	31	31	31	31	31	31	31	31	31	31
	3	cm	78.7	78.7	78.7	78.7	78.7	78.7	78.7	78.7	78.7	78.7	78.7	78.7